SCOTCH-BRITE™ SURFACE CONDITIONING BELTS

TRUST SCOTCH-BRITE™ BELTS TO DELIVER FANTASTIC FINISHES.

RECOMMENDED BACKINGS = Recommended Starting Point				<u>• * •</u>		© ,(\)	
✓ = Secondary Starting Point		File Belt	In-Line Sander	Stroke Sander	Back Stand	Centerless / Cylindrical	Flat Finishing
Scotch-Brite [™] SC Surface	SCRIM	✓	✓				
	LOW STRETCH*				✓	✓	✓
Conditioning Belt	FILM BACKED			✓			
Scotch-Brite [™] Durable Flex (DF) Surface Conditioning Belt	LOW STRETCH*	✓	~		~	✓	√
Scotch-Brite [™]	SCRIM	√	~				
SE Surface Conditioning Belt	LOW STRETCH*				✓	✓	✓
	FILM BACKED			~			

^{*}Low stretch is ideal for high tension or long belt applications







RECOMMENDED OPERATING SPEEDS					
APPLICATION	SFPM				
Decorative Finishing	500-3,000				
Deburring	5,000-6,500				
Cleaning and Conditioning	2,000 – 5,000				
Oxide Removal	4,500 – 6,500				
Maximum Operating Speed: 6,500 SFPM SFPM = Surface Feet Per Minute					

THE EASIEST WAY TO A PERFECT FINISH.

Choose Scotch-Brite™ Surface
Conditioning Belts for cleaning,
finishing, blending and deburring.
The reinforced backing offers
good flexibility whether working
on a file belt or backstand. The
nonwoven material combined
with abrasive grain is an ideal
way to add a great finish or
remove burrs without gouging or
undercutting the work piece.



Check out this additional content!



LEARN MORE

3M.com/ScotchBriteAbrasives

35

APPLICATIONS

SYSTEMS

AUTOMATION

ABRASIVES


TOOLS AND ACCESSORIES

SAFETY

CRACKING THE COLOR CODE — BELTS

HAVE CONFIDENCE THAT YOU ARE USING THE REAL DEAL.

Recognizing the authentic Scotch-Brite[™] Brand colors can help you to quickly identify quality nonwoven abrasives — and their grades.¹

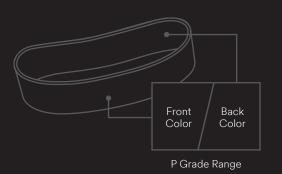

	tch-Brite [™] Surface aditioning Belts	SFN Super Fine	VFN Very Fine	FIN Fine	MED Medium	CRS Coarse	HD-CRS Heavy Duty	SD-CRS Super Duty
MULTIPURPOSE	SC	600-400	JE Scotch JEN SCA- Brite Scotch 400–320		90 A-ME AC SHOW MED SC A-1 30772 SGB 240–180	C A-CRS No Scool Scool RS SC A-CR Ente Scool 180–150		
FLEXIBLE	Durable Flex (DF)			280–240	240-180	180-150		
HEAVY DUTY	SE			280-240	240–180	150–120		
HEAV	Light Grinding and Blending						180–150	150–120

P GRADES

3M.com/ScotchBriteAbrasives | 36

^{1.} Scotch-Brite™ nonwoven abrasives, grade is generally used to describe the finish attributes — the coarser the grade, the more aggressive cut and finish. P Grade ranges for Scotch-Brite™ Belts are based on comparative finishes to 3M coated belts (tested on stainless steel). Grade ranges are reference point only — listed from finer to coarser. Measured finish will be affected by operator, tool, accessories used, substrate and application, and provided ranges are reference point only.


SCOTCH-BRITE™ SURFACE CONDITIONING BELTS






Is your belt wearing out too fast? Try the Scotch-Brite™ SE Surface Conditioning Belt.

Build Your System

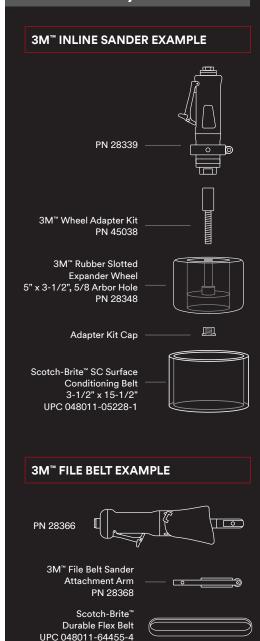

SCOTCH-BRITE™ SURFACE CONDITIONING BELTS



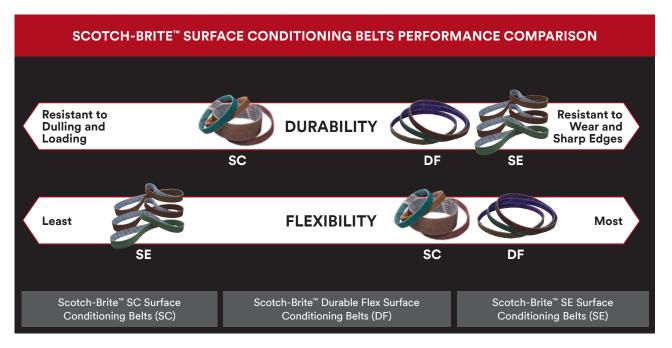

Scotch-Brite[™] SE Surface Conditioning Belts

